

Affected equipment

Emergency canopy P512 (P/N 2004710600).
Harness container FLEXPACK (P/N 80020130 or 8002013000)

Observations

Damaging of the P512 emergency canopy during a high speed opening test (150 Kts).The configuration was different from the qualified one.

Analyze

The damages are due to one or more overlins causing the damage of several panels. It is likely that this incident is due to one or more lines passing over the diaper during the extraction of the container.

Recommendation for use (Further to Safety Bulletin n° 05/001 from 02/06/2005).

Whereas the incident happened in a configuration different than the qualified one, and by safety-first principle :

- To replace the current rubberbands by **mini rubberbands optima P/N 2015000600** (Cf picture 2).
- To use an additional mini rubberband optima on attachment tapes number 11 (diaper line) in order to add an additional stow at the beginning of the stowage (Cf picture 1).

Implementation

The recommendations are applicable before the next use of the safety parachute.

Publication

This safety Bulletin has to be joined as an additional to the use and maintenance manual P/N 9009113300.

Those packing recommendations will be integrated in the next issue of the use and maintenance manual P/N 9009113300.

PICTURE 1



PICTURE 2

